Syncrowave 250 DX/350 LX TIG/Stick Welding Power Source



Quick **Specs**

Standard

Machine

Maintenance and Repair Light and Heavy Manufacturing Aerospace Shipbuilding

Light Industrial Applications

Precision Metal Fabrication

Tube and Pipe Automotive Vocational

Processes

TIG (GTAW) Stick (SMAW) Pulsed TIG (GTAW-P) (Optional on 250 DX models) Air Carbon Arc (CAC-A) **250:** 3/16-in. maximum **350:** 1/4-in. maximum

Input Power

1-Phase Power

Amperage Range 250: 3-310 **350:** 3-400

Max. Open-Circuit Voltage 80 VDC

Rated Output 250: 250 A at 30 VAC, 40% Duty Cycle

200 A at 28 VAC, 60% Duty Cycle

350: 350 A at 34 VAC, 40% Duty Cycle 300 A at 32 VAC, 60% Duty Cycle

Net Weight

Standard: **250:** 378 lb. (172 kg) **350:** 496 lb. (225 kg) **TIGRunner®: 250:** 478 lb. (217 kg) **350:** 596 lb. (270 kg)



See Page 2 for **Additional Features**

Syncrowave Complete Package comes complete with:

- Syncrowave® power source
- Coolmate[™] 3CS cooler
- No. 37 running gear
- TIG torch kit with accessories
- Remote foot control
- Four gallons of coolant

AC balance control provides adjustable oxide removal which is essential for creating the highest quality aluminum welds.

Syncro Start™ allows the choice of Soft. Medium or Hot TIG starts based on the tungsten size and application.

Digital welding meters display both amperage and voltage for viewing of the actual and preset values for greater accuracy and repeatability in your welding procedure.

High frequency for non-contact arc initiation that reduces tungsten and material contamination.

Last procedure recall simplifies changing your Syncrowave back and forth from aluminum TIG to stainless TIG to Stick welding. One switch makes all the control panel changes.



Power source is warranted for 3 years, parts and labor. Original main power rectifier parts are warranted for 5 years.



Miller Electric Mfg. Co.

An ITW Company 1635 West Spencer Street P.O. Box 1079 Appleton, WI 54912-1079 USA

Equipment Sales US and Canada

Phone: 866-931-9730 FAX: 800-637-2315 International Phone: 920-735-4554 International FAX: 920-735-4125







Additional Features

Pulse. Pulsing can increase puddle agitation, arc stability and travel speeds while reducing heat input and distortion (optional on 250 DX model).

TIGRunner™ system packages with Coolmate™ 3CS cooler. A three-gallon cooling system equipped with a visual flow indicator ensures that the coolant is flowing. An external coolant filter stops foreign objects from entering the water-cooled torch cable for better flow and longer life. Extended cooling capacity ensures maximum productivity. Three-year cooler warranty.

Hot Start™ adaptive control provides positive arc starts without sticking.

Tilted operator interface provides added convenience to your welding experience.

Arc timer/cycle counter records actual welding time and number of arc starts. Great for estimating job costs.

Squarewave technology. Developed by Miller in 1976 to improve your weld quality and make TIG welding easier. Provides arc stability when welding aluminum, prevents arc rectification and eliminates tungsten erosion.

Welding aluminum? Oxides that form on aluminum melt at temperatures over 3700 degrees Fahrenheit. The aluminum material that is located under this layer of oxide melts at 1200 degrees Fahrenheit. The Syncrowave's AC Squarewave welding current automatically removes the layer of oxide which is necessary for producing high quality welds.

Do you have power fluctuations?

The Syncrowave compensates for power fluctuation without changing your welding parameters. **Line voltage compensation** works on fluctuating power ±10 percent.

Easy load dual cylinder rack (see photo at right) minimizes cylinder lifting. Cylinder is not included.



AC Output: Balance Control

Balanced Wave Function AC Balance Balanced Wave 50% Medium bead Electrode Positive 50% Electrode Balanced Visible oxide Negative removal (etching) More Heat into Work Narrower bead for fillet welds Electrode Positive 68% Electrode Min. Negative Minimum oxide Cleaning removal (etching) **Greatest Cleaning Action** Medium bead Electrode Positive Bead 45% Electrode Cleaning Visible oxide Negative removal (etching)



Specifications (Subject to change without notice.)







| Model | Input Power | Welding Amperage Range | Rated Output | Amps 200V | | | | , | ed Loa 460V | | 575V | KVA | KW | Max. OCV | Dimensions | Net Weight |
|--|----------------------------|------------------------------|----------------------------------|--------------|-----|-----|----|----|----------------|----|------|-----|----|-------------|--|--|
| Syncro 250 | 1-phase, 60 Hz | 3-310 A | 250 A at 30 V, 40% duty cycle | 110 | _ | 96 | _ | _ | 48 | _ | 38 | 22 | 12 | 80 V | H: 33.25 in. (845 mm)* W: 22.5 in. (572 mm) D: 25 in. (635 mm)** | 378 lb. (172 kg) |
| | 1-phase, 50 Hz | 3-310 A | 225 A at 29 V, 40% duty cycle | 101 | _ | 88 | _ | _ | 44 | _ | 35 | 20 | 10 | | with TIGRunner® H: 46 in. (1168 mm)* W: 28.5 in. (724 mm) D: 40.5 in. (1029 mm)** | with TIGRunner® 478 lb. (217 kg) |
| Syncro 250 IEC 220/400/ 440/520 | 1-phase, 50 or 60 Hz | 3-310 A | 250 A at 30 V, 40% duty cycle | _ | 100 | _ | 55 | 50 | _ | 42 | _ | 22 | 12 | 80 V | H: 33.25 in. (845 mm)* W: 22.5 in. (572 mm) D: 25 in. (635 mm)** | 378 lb. (172 kg) |
| Syncro 350 All Models | 1-phase, 50 or 60 Hz | 3-400 A | 350 A at 34 V, 40% duty cycle | 146 | 120 | 128 | 66 | 60 | 65 | 51 | 50 | 30 | 14 | 80 V | H: 33.25 in. (845 mm)* W: 22.5 in. (572 mm) D: 25 in. (635 mm)** with TIGRunner® H: 46 in. (1168 mm)* W: 28.5 in. (724 mm) D: 40.5 in. (1029 mm)** | 496 lb. (225 kg) with TIGRunner® 596 lb. (270 kg) |

DUTY CYCLE CHART

Notes: See page 6 for Power Factor Correction Kit.

IEC models conform to the following standards: IEC 60974-1: 2005, IEC 60974-10: 2004, and EN 50445



Certified by Canadian Standards Association to both the Canadian and U.S. Standards.

Performance Data

100

50

RATED OUTPUT -500 450 400 Syncrowave 350 LX 350 300 Syncrowave 250 DX 250 WELDING AMPERES 200 150

30

% DUTY CYCLE

50

60


70

80

90 100

^{*}Add 3 inches (76 mm) for lift eye. **Add 1.5 inches (38 mm) for handle.

Control Panels

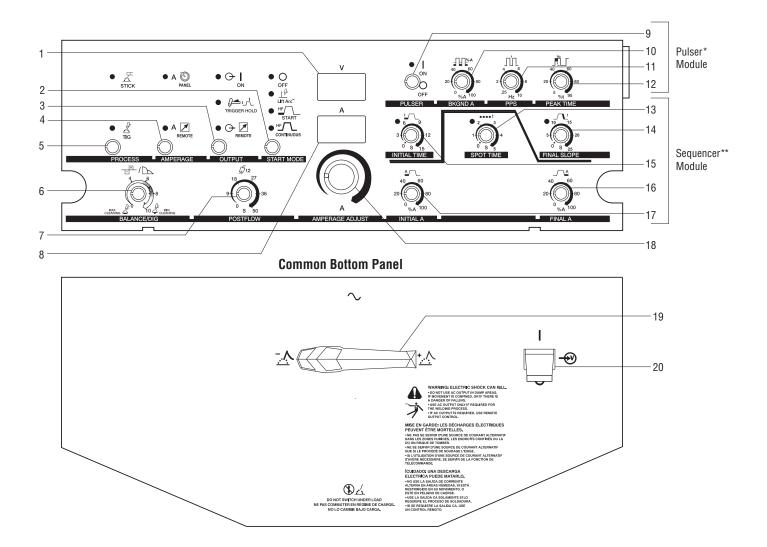

- 1. Voltmeter Display
- 2. Start Mode Control (Lift-Arc™, HF Start, HF Continuous)
- 3. Output Control
- 4. Amperage Control (Panel/Remote)
- 5. Process Control (Stick/TIG)
- 6. Balance/Dig Control (0−10)
- 7. Postflow Time Control (0-50 seconds)
- 8. Ammeter Display
- 9. Pulser Control*
- 10. Background Amps Control (0-100%)*
- 11. Pulse-Per-Second Control (0.25-10 Hz)*
- **12.** Peak Time Control (5-95%)*

- 13. Spot Time Control (0-5 seconds)**
- 14. Final Slope Control (0-25 seconds)**
- 15. Initial Time Control (0-15 seconds)**
- 16. Final Amperage Control (0-100%)*
- 17. Initial Amperage Control (0-100%)**
- 18. Amperage Adjustment Control (3-310/400 A)
- **19.** Output Selector Switch (AC/DC-/DC+)
- 20. Power Switch (On/Off)

*Optional Pulser for 250 DX

**Optional Sequencer



Syncrowave 250 DX and 350 LX Models/Packages



Standard Model



Syncrowave Complete (Syncrowave TIGRunner, TIG Coolant and Torch Kit)

Syncrowave TIGRunner



W-250 (WP-20) Torch Kit for Syncrowave 250 DX TIGRunner



W-375 Torch Kit for Syncrowave 350 LX TIGRunner

Syncrowave Power Sources

Syncrowave 250 DX

#907 194 (200/230/460 VAC)

#907 195 (230/460/575 VAC)

#907 516 (220/400/440/520 VAC) IEC

Syncrowave 350 LX

#907 198 (200/230/460 VAC)

#907 199 (230/460/575 VAC)

#907 517 (220/400/440/520 VAC) IEC

TIG torch connector sold separately. Power cord NOT included.

TIGRunner® Packages

Syncrowave 250 DX TIGRunner 3CS

#907 194 032 (200/230/460 VAC)

#907 195 032 (230/460/575 VAC)

Syncrowave 350 LX TIGRunner 3CS

#907 198 032 (200/230/460 VAC)

#907 199 032 (230/460/575 VAC)

Completely assembled. TIGRunner includes Syncrowave power source, Coolmate™ 3CS cooler, No. 37 running gear, and RFCS-14 HD remote foot control.

TIG torch connector, Dinse-style connector and TIG coolant sold separately. Power cord NOT included.

Complete Packages

Syncrowave 250 DX Complete

#951 117 (200/230/460 VAC)

#951 118 (230/460/575 VAC)

Syncrowave 350 LX Complete W-375

#951 622 (200/230/460 VAC)

#951 623 (230/460/575 VAC)

Completely assembled. Includes TIGRunner above (Syncrowave, Coolmate™ 3CS cooler, No. 37 running gear, and RFCS-14 HD remote foot control), plus four gallons of TIG coolant and a water-cooled torch kit (see kits at left) consisting of TIG torch, cable cover, accessory kit, flowmeter regulator, gas hose, torch connector, and work clamp with cable and Dinse-style connector.

Power cord NOT included.



Genuine Miller® Options

Field Options

Sequencer Module

#300 547 Field. For Syncrowave 250/350 *Effective with serial number LE282983.* Provides a starting current higher or lower than the welding current. Provides final slope and final current for trailing the weld. Provides a spot timer for TIG spot application.

Pulser Module

#300 548 Field. For Syncrowave 250 DX *Effective with serial number LE282983.* For welding of thin materials. Provides a heating and cooling effect of the weld puddle to reduce heat input and control distortion of the material. Provides 0.25 to 10 pulses per second.

Power Factor Correction Kit

#194 692 Field. For Syncrowave 250 DX **#043 757** Field. For Syncrowave 350 LX Reduces primary amperage draw by approximately 25 percent allowing the use of smaller breakers/fuses and smaller power cord. Kit does *NOT* reduce the power consumption/electrical bill.

Genuine Miller® Accessories



No. 37 Running Gear #195 282 Includes two 10-inch (254 mm) wheels, two 5-inch (127 mm) casters, twocompartment rack (for gas cylinder(s), and handles. Provides excellent mobility and easy to install.

Protective Cover #195 320

Heavy-duty, water- and mildew-resistant. Protects and maintains the finish of the welder.

Remote Controls and Switches



Wireless Remote Foot Control #300 429

For remote current and contactor control. Receiver plugs

directly into the 14-pin receptacle of Miller machine. 90-foot (27.4 m) operating range.



Wireless Remote Hand Control #300 430

For remote current and contactor control.

Receiver plugs directly into the 14-pin receptacle

of Miller machine. 300-foot (91.4 m) operating range.



RCCS-14 Remote Contactor and Current Control #043 688

North/south rotary-motion fingertip control attaches to TIG torch using two hook-and-loop fasteners. Great for applications that require a finer amperage control. Includes 26.5-foot (8 m) cord and 14-pin plug.



RCC-14 Remote Contactor and Current Control #151 086

East/west rotary-motion fingertip control attaches to TIG torch using two hook-and-loop fasteners. Great for production or contractors that need quick ramp-up. Includes 26.5-foot (8 m) cord and 14-pin plug.



RFCS-14 HD Foot Control #194 744

Maximum flexibility is accomplished with a reconfigurable cord that can exit the front, back or either side of the pedal. Foot pedal provides remote current and contactor control. Includes 20-foot (6 m) cord and 14-pin plug.



RHC-14 Hand Control #242 211 020

Miniature hand control for remote current and contactor control. Dimensions: 4 x 4 x

3.25 inches ($102 \times 102 \times 83 \text{ mm}$). Includes 20-foot (6 m) cord and 14-pin plug.



RMLS-14 Switch #129 337

Momentary- and maintained-contact rocker switch for contactor control. Push forward for maintained contact and backward for momentary contact. Includes 26.5-foot (8 m) cord and 14-pin plug.



RMS-14 On/Off Control #187 208

Momentary-contact switch for contactor control. Rubber-covered pushbutton dome switch ideal for repetitive on-off applications. Includes 26.5-foot (8 m) cord and 14-pin plug.

Extension Cables for 14-Pin Remote Controls

#242 208 025 25 ft. (7.6 m)

#242 208 050 50 ft. (15.2 m)

#242 208 080 80 ft. (24.4 m)

Coolant Systems

For more information, see the Miller Coolant Systems literature sheet, Index No. AY/7.2.



Coolmate™ 3X #300 419

Includes easy-load dual cylinder rack, running

Includes Wheels gear, handles and 3CS industrial water cooler — a perfect solution for water-cooled TIG torches.



Low-Conductivity TIG Coolant #043 810

Sold in multiples of four in one-gallon recyclable plastic bottles. Miller

coolants contains a base of ethylene glycol and deionized water to protect against freezing to -37° Fahrenheit (-38° C) or boiling to 227° Fahrenheit (108° C).



Genuine Miller Accessories (continued)

TIG (GTAW) Torch Connectors



Water-Cooled TIG Torch Connector #195 377

50-mm Dinse-style with water return line. For use with all Weldcraft™ water-cooled torches.



Air-Cooled TIG Torch Connector #195 379 Used to adapt a Weldcraft™ A-200 (WP-26) torch to a Dinse-style connector.

Educational Materials

To order, please call Miller Literature at 866-931-9732 or visit MillerWelds.com/resources/tools.

Gas Tungsten Arc Welding (TIG) Publication #250 833

TIG Training DVD #196 567

Designed for anyone who's looking to better understand the TIG process. Easy to understand instruction, proven teaching steps, and expert advice help to create a more effective academic approach to training. Subject areas covered include system components, process fundamentals, electrical theory, safety, power source operation.

Video – GTAW Setup Procedures #108 241

A detailed demonstration on preparing your equipment for TIG welding. Uses a Syncrowave 250 power source, but topics fit any TIG setup including air-or water-cooled systems. In-depth discussion of tungstens and gases. 13:00 minutes.

TIG Welding Gloves



Performance TIG Gloves

#263 345 X-Small (Women's)

#263 346 Small (Women's)

#263 347 Medium

#263 348 Large

#263 349 X-Large

Completely unlined, goat grain leather with triple-padded palm.

Water-Cooled Torch Kits



W-250 (WP-20) Torch Kit #300 185 Recommended for Syncrowave 250 DX

- Weldcraft™ W-250 (WP-20) 25-foot (7.6 m) TIG torch with Dinse-style connector
- Torch cable cover
- Work clamp with 15-foot (4.6 m) 1/0 cable and Dinse-style connector
- Flowmeter regulator
- Gas hose (regulator to machine)
- AK4C torch accessory kit includes nozzles, collets, collet bodies and 2% ceriated tungsten electrodes (1/16, 3/32 and 1/8 inch)



W-375 Torch Kit #301 268

Recommended for Syncrowave 350 LX

- Weldcraft[™] W-375 25-foot (7.6 m) TIG torch with Dinse-style connector
- Torch cable cover
- Work clamp with 15-foot (4.6 m)1/0 cable and Dinse-style connector
- Flowmeter regulator
- Gas hose (regulator to machine)
- AK4C torch accessory kit includes nozzles, collets, collet bodies and 2% ceriated tungsten electrodes (1/16, 3/32 and 1/8 inch)



W-400 (WP-18SC) Torch Kit #300 186

- Weldcraft™ W-400 (WP-18SC) 25-foot (7.6 m) TIG torch with thread lock connector
- Torch cable cover
- Work clamp with 12-foot (3.7 m)4/0 cable with thread lock connector
- Flowmeter regulator
- Gas hose (regulator to machine)
- AK18C torch accessory kit includes nozzles, collets, collet bodies and 2% ceriated tungsten electrodes (3/32, 1/8 and 5/32 inch)

Note: Requires Water-Cooled TIG Torch Connector #195 377 (sold separately) for Syncrowave 250 DX and 350 LX.

Tungsten

| Tungsten | Amp Range | 2% Ceriated (AC/DC) | 2% Lanthanated (AC/DC) |
|-------------------|-------------|---------------------|------------------------|
| 1/16 in. (1.6 mm) | 70-150 A | WC116X7 | WL2116X7 |
| 3/32 in. (2.4 mm) | 140-250 A | WC332X7 | WL2332X7 |
| 1/8 in. (3.2 mm) | 225 – 400 A | WC018X7 | WL2018X7 |
| 5/32 in. (4.0 mm) | 300-500 A | WC532X7 | WL2532X7 |



Ordering Information

| Equipment and Options | Stock No. | Description | Qty. | Price |
|---|--------------------------|---|------|-------|
| Syncrowave® 250 DX | #907 194 | 200/230/460 V, 50/60 Hz, Standard Model | | |
| | #907 195 | 230/460/575 V, 50/60 Hz, Standard Model | | |
| | #907 516 | 220/400/440/520 V, 50/60 Hz, IEC | | |
| | #907 194 032 #951 117 | 200/230/460 V, 50/60 Hz, Syncrowave 250 DX TIGRunner® 3X 200/230/460 V, 50/60 Hz, Syncrowave 250 DX Complete | | |
| | #907 195 032 | 230/460/575 V, 50/60 Hz, Syncrowave 250 DX TIGRunner® 3X | | |
| | #951 118 | 230/460/575 V, 50/60 Hz, Syncrowave 250 DX Complete | | |
| Syncrowave® 350 LX | #907 198 | 200/230/460 V, 50/60 Hz, Standard Model | | |
| | #907 199 #907 517 | 230/460/575 V, 50/60 Hz, Standard Model 220/400/440/520 V, 50/60 Hz, IEC | | |
| | #907 198 032 | 200/230/460 V, 50/60 Hz, Syncrowave 350 LX TIGRunner® 3X | | |
| | #951 622 | 200/230/460 V, 50/60 Hz, Syncrowave 350 LX Complete | | |
| | #907 199 032 | 230/460/575 V, 50/60 Hz, Syncrowave 350 LX TIGRunner® 3X | | |
| | #951 623 | 230/460/575 V, 50/60 Hz, Syncrowave 350 LX Complete | | |
| Sequencer Module | #300 547 | Field. For Syncrowave 250 DX and 350 LX | | |
| Pulser Module | #300 548 | Field. For Syncrowave 250 DX | | |
| Power Factor Correction Kit | #194 692 #043 757 | Field. For Syncrowave 250 DX Field. For Syncrowave 350 LX | | |
| TIG Torch Kits and Connectors | | | | |
| Water-Cooled Torch Kits | #300 185 | W-250 (WP-20) (recommended for Syncrowave 250 DX) | | |
| | #300 990 | W-280 (WP-280) | | |
| | #301 268 #300 186 | W-375 (recommended for Syncrowave 350 LX) W-400 (WP-18SC) | | |
| Water-Cooled TIG Torch Connector | #195 377 | Connects Weldcraft™ water-cooled torches to Dinse-style connector | | |
| Air-Cooled TIG Torch Connector | #195 379 | Connects Weldcraft™ A-200 (WP-26) torch to Dinse-style connector | | |
| Tungsten | | See page 7 | | + |
| Remote Controls | | Coo page 1 | | |
| Wireless Remote Foot Control | #300 429 | Foot control with wireless 90-ft. (27.4 m) operating range | | - |
| Wireless Remote Hand Control | #300 430 | Hand control with wireless 300-ft. (21.4 m) operating range | | |
| RCCS-14 | #043 688 | North/south fingertip control | | |
| RCC-14 | #151 086 | East/west fingertip control | | |
| RFCS-14 HD | #194 744 | Heavy-duty foot control | | |
| RHC-14 | #242 211 020 | Hand control | | - |
| RMLS-14 | #129 337 | Momentary/maintained rocker switch | | |
| RMS-14 | #187 208 | Momentary rubber dome switch | | |
| Extension Cables | #107 200 | See page 6 | | |
| Accessories | | The result of | + | + |
| No. 37 Running Gear | #195 282 | | | - |
| Protective Cover | #195 320 | | | |
| Coolmate™ 3X | #300 419 | Coolmate 3CS with cart and dual cylinder rack | | - |
| TIG Coolant | #043 810 | 1-gallon plastic bottle. Protects against freezing to | | |
| (Must be ordered in quantities of four) | | -37° Fahrenheit (-38° C) or boiling to 227° Fahrenheit (108° C) | | |
| Cable Connectors | | Supplied with power source and torch kits | | |
| Dinse-Style Connector 50 mm (1 male) | #042 418 | Used to connect weld lead to Dinse terminal machine | | |
| Dinse-Style Connector 50 mm (1 male, 1 female) | #042 419 | Used to extend weld cables | | |
| Dinse/Tweco® Adapter | #042 465 | Male Dinse to female Tweco | | |
| Dinse/Cam-Lok Adapter | #042 466 | Male Dinse to female Cam-Lok | | |
| Gas Tungsten Arc Welding (TIG) Publication | #250 833 | | | |
| TIG Training DVD | #196 567 | | | |
| Video – GTAW Setup Procedures | #108 241 | | | |
| TIG Welding Gloves | | See page 7 | | |

Date: Total Quoted Price:

Distributed by:

